



Textilní zkušební ústav, s.p.

(Textile Testing Institute)
Václavská 237/6, 60300 Brno, Česká republika


TESTING LABORATORY NO. 1001
accredited according to EN ISO/IEC 17025:2005 by the Czech Accreditation Institute

TEST REPORT

AZL 18 /0967-02

CUSTOMER : Englisch Dekor HandelsgmbH & CO.KG
Scheydgasse 29
1210 Wien
Austria

SAMPLE : Upholstery – A 3246 – A 3251
(according to the customer order) Fibre composition: 51% Polyester/41% Cotton/2% Acryl/4%
Viscose/2% Linen
Weight : 385 g.m⁻²

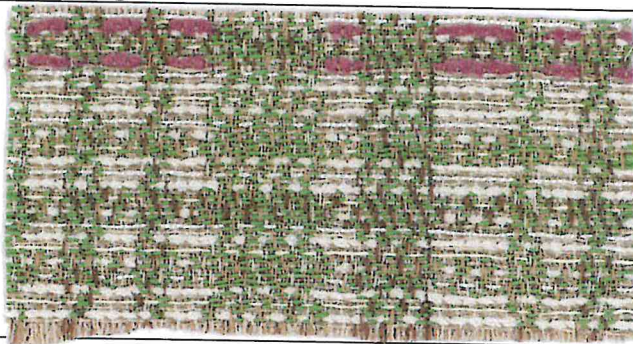

SUBJECT OF ASSESSMENT :

Abrasion resistance

**CONDITIONS OF
APPLICATION OF THE TEST
REPORT :**

Test Report contains results of the tests related to the submitted sample only. Sampling has been done by customer. The Report may not be reproduced in any way other than as a complete set. Reproduction of certain parts of the Report is subject to approval of the test laboratory, which has issued it. All information about subcontracted tests results or unaccredited test methods is presented in text part of the test report. This Report is a literal translation of the Czech version.

PREPARED BY :
CHECKED BY :
NUMBER OF PAGES :

Čermáková *Čermáková*
Tichá *Tichá*
2

**DATE OF
ACCEPTANCE :**
14.09.2018

**DATE OF
EXAMINATION :**
17.-21.09.2018

**DATE OF
ISSUE :**
24.09.2018



☎420 543 426 713
☎+420 543 426 742
🌐<http://www.tzu.cz>
✉fzz@tzu.cz



PROCEDURE OF ASSESSMENT

Textiles - Determination of the abrasion resistance of fabrics by the Martindale method

Part 2 : Determination of specimen break down

was determined according to EN ISO 12947-2

- Standard atmosphere for testing : relative humidity 64%, temperature 20°C
- Conditioning : relative humidity ($65,0 \pm 4,0$)%, temperature ($20,0 \pm 2,0$)°C
- Abrasion machine : Martindale SDL - M 235
- Load used : 12 kPa (795 ± 7)g

TEST RESULTS:

Upholstery – A 3246 – A 3251 Fibre composition: 51% Polyester/41% Cotton/2% Acryl/4% Viscose/2% Linen Weight : 385 g.m ⁻²			
Characteristics	Testing method	Measuring unit	Values identifiant
Abrasion resistance • interval two threads break or when the pile is fully worn of at number of cycles - sample No. 1 - sample No. 2 - sample No. 3 • average number of rubs at which specimen break down occurs • standard error of measurement for level of reliability 95%	EN ISO 12947-2	number of revolutions	50 001-60 000 50 001-60 000 50 001-60 000 55 000 0

Petr Nasadil
Head of Testing Laboratory

